
## TO READ 24" - 36" (609.60mm - 914.40mm) DIGITAL OUTSIDE DIAMETER/CIRCUMFERENCE TAPES

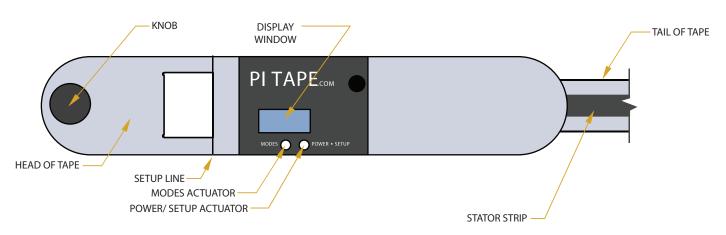

## U.S. Patent No. 9,829,298

Instructions for 24" – 36" (programmed at 36"):

**I TAPE**°

1) Insert the tail of tape through the window at the head of tape, then slide the tail underneath the digital unit to prepare for setting up lines (listed on step 3 below).

NOTE: Use care when sliding the stator strip underneath the digital unit.

- 2) Turn on the digital unit by pushing the right button until the dashes are displayed.
- 3) Position the tape so that the set-up line on the head of the tape lines up exactly with the 36" set-up line on the tail of the tape.
- 4) Push the right button until "SET" is displayed. The digital unit should now display the measurement that corresponds with the set-up line.
- 5) Take the readings while applying 5 lbs. tension. The left button is multi-functional. Pressing it repeatedly will display the different measurement modes. The measurement modes offered are metric circumference, metric diameter, inch circumference, and inch diameter.
- 6) When not in use, the digital unit turns off automatically after approximately 5 minutes.

**NOTE**: If digital unit needs to be reset or error message is shown, turn off digital unit by pressing right button until all characters disappear. Then repeat steps 2 through 4.

The diameter display has a resolution of .0005''(.01 mm) with an overall tape accuracy of  $\pm .003''(\pm .09 \text{ mm})$ .

**ADVISORY:** Should any repairs be needed, please contact us. Opening the housing unit may result in voiding the manufacturer's warranty. For battery replacement, please see the Digital Battery Change Instruction Sheet.

**CARE:** Keep tape clean and dry.

PI TAPE and the 🖶 logo are trademarks of Pi Tape Texas, LLC, and they are registered in the USA and in 45 other countries. Please visit https://www.pitape.com/trademarks.htm for a list of countries in which our trademarks are registered.